

Firmware Update **Onkyo TX-NR797,** **TX-RZ740 & TX-RZ840** (10-14-2021)

We are pleased to offer this firmware update for the best possible performance of your Onkyo AV Receiver.

This update may be installed via USB or Network.

TX-NR797, TX-RZ740 & TX-RZ840
(Current Version **R127-0911-1141-0030)**

The 10/14/2021 update will address the following:

1. Chromecast built-in version update to 1.52.
2. Fix the playback format issue converted as AAC format while playing TIDAL's FLAC audio format.

The 06/08/2021 update will address the following:

1. Add search function for SONOS device on Web Setup Menu.
2. Increase the upper limit of connectable SONOS device from 8 to 32.
3. Fix the issue which the error of when accessing Web Setup Menu via OvrC HUB.

Previous Update

The 12/22/2020 update will address the following:

1. Update Chromecast built-in version to 1.44.
2. Support ALLM "Auto Low Latency Mode".
3. Fix the issue that cannot display the logo of certain TuneIn Radio stations.
4. Improve reception capability in certain TuneIn Radio stations.

The 10/28/2020 update will address the following:

1. Enhance network security.

"username" and "password" will be required to use Web Setup feature after this update.*

*Please refer to the link below for more details.

https://www.onkyo.com/manual/sup/upd/websetup_onk.pdf

2. Change login method of TIDAL for enhancing security.*

*Please refer to the link below for more details.

https://www.onkyo.com/manual/sup/upd/tidal_onk.pdf

3. Add "Center Spread" setting for Dolby signals.*

*Please refer to the link below for more details.

https://www.onkyo.com/manual/sup/upd/centerspread_onk.pdf

4. Minor bug fixes and improvements stability.

The 08/04/2020 update will address the following:

1. Support "Critical Listening mode of DTS Play-Fi"
2. Unlock IP/Serial/IR/Front Panel volume controls if using Sonos "Volume Pass-Through" feature
3. Minor bug fixes and improvements stability.

The 03/12/2020 update will address the following:

1. Support "Volume Pass Through" mode for Sonos.*

* For details about updated function, please refer to the link below.

https://www.onkyo.com/manual/txnr595/supple_595.pdf

2. Update Chromecast built-in version to 1.40.
3. Improve the list viewing for "Albums/ Artists/ Songs" in My Music of Amazon Music.
4. Fix the issue of Bluetooth connection with certain iOS devices.

The 12/17/2019 update will address the following:

1. Support 'Works with Alexa'.*
2. Support control of multiple Sonos Connect.*
3. *For detail about updated function, please refer to the link
below.
https://integraworldwide.com/manual/drx23/supple_23.pdf
4. Minor bug fixes and improvements stability.

The 08/01/2019 update will address the following:

1. Support IMAX Enhanced.*
2. Support Dolby Atmos Height Virtualizer.*
3. *For detail about updated function, please refer to the link below.
https://www.onkyo.com/manual/txnr595/supple_595.pdf
4. Update Chromecast built-in version to 1.36.
5. Improve playback stability for FLAC files.
6. Change maximum value of My Input Volume from 50 to 80.

The 4/18/2019 update will address the following:

1. Minor bug fixes and improvements stability.

To check if your firmware is the latest version, go in to Setup -> Misc. -> Firmware Update and check the version number. If any of the numbers differ from the latest version available, please update your unit.

Update via USB storage

Note: Please remove the wired/wireless connection before updating through USB. Please prepare a USB storage device such as a USB flash memory stick. You need at least 128 MB of available space to update the firmware. Please unpack the ZIP file onto an empty USB Stick that has been formatted with the FAT file system.

We hope you enjoy the improved functionality this update provides to your AV Receiver.

Precautions for the Firmware Update

Please read the update instructions carefully before beginning.

The firmware update should take up to 30 minutes. Once the update begins, don't turn off the power supply to the A/V receiver until it is time to restart it.

Depending on the conditions of the network, a firmware update via a network may take more than one hour or even fail to finish. If the update is not completed within two hours, turn off the power supply by pushing the ON/STANDBY button and then try updating again from the beginning.

Updating the firmware and adjusting the settings will be done automatically, but may take some time to complete. Please follow the procedures as instructed when you update. Note that the update may fail, or cause problems for your A/V receiver, if you do any of the following:


- Pull out the A/V receiver's power cord;
- Interrupt the power supply to the A/V receiver (e.g. if the breaker is tripped or if there is an electrical outage);
- Insert or remove the LAN cable from a device in your network when updating over a network;
- Insert or remove a USB memory device from the A/V receiver when updating via USB;
- Operate components connected to the A/V receiver via HDMI, such as a TV or a recording device.


If your A/V receiver is damaged for any of the reasons above, an Onkyo service center will repair the unit for a fee.

If you see "No Update" on the front panel immediately after you have started the firmware update process, you have the latest firmware. In this case it is not necessary to do this update.

How to prepare the USB Memory Device:

1. Download the zipped firmware update file and save to the Desktop of your computer
2. Right click on the file and select "Extract All" and place the extracted folder on the Desktop of your computer:

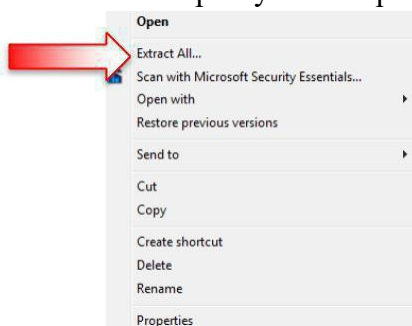

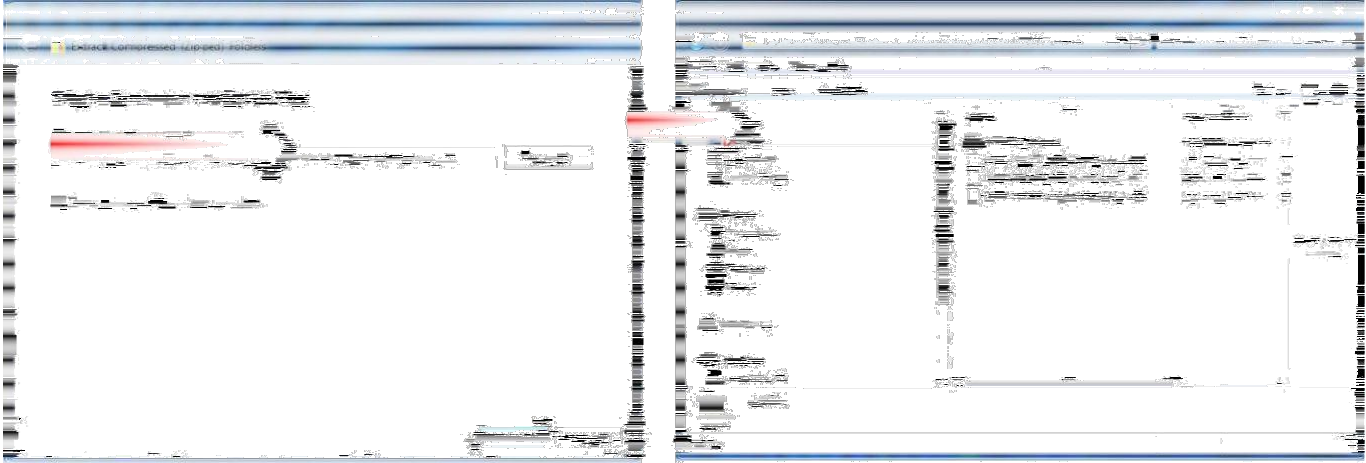

1. Connect the USB Memory Device to the USB port of your computer and copy the **contents of the unzipped/extracted folder** onto your USB Memory Device.
2. Safely eject the USB Memory Device from your computer.

How to upgrade the firmware via USB:

1. Insert the USB Memory Device containing the software into the USB port of the receiver.
2. Turn on the receiver and select the SETUP input on the front panel, then select "7.Misc", press Enter, then "F/W Update" and press Enter, scroll down to select "Update via USB".
3. Press the "Enter" button on the front panel to begin the update.
4. Do not shut the unit off until "Complete" is shown on the front display. This will take up to 30 minutes.
5. Once the update has completed check the firmware version to confirm that the unit is fully up to date. If it is not, run the update again.

To check the firmware version, press the SETUP button on the front panel. Highlight "7.Misc" and press enter. Highlight "F/W Update" and press Enter. Scroll down to the Firmware Version number to verify the current installed version.

How to upgrade the firmware via Network:

1. If the unit is connected via LAN and there is firmware update available, the "Firmware Update Available" message may appear. To execute updating, select "Update Now" with the cursor buttons of the remote controller and press ENTER. The unit automatically turns itself into standby mode about 30 minutes after "Completed!" appears on the display, and updating will be complete.
2. Alternatively, to force an update, select "SETUP" on the front panel, then scroll and select "8.Misc", "F/W Update" "Update Via NET" and press ENTER.
 - If "Firmware Update" is grayed out and cannot be selected, wait for a while until it starts up.
 - You will not be able to select "Update via NET" if there is nothing to update.
3. Press ENTER with "Update" selected to start update.
 - During the update, the TV screen may go black depending on the updated program. In that case, check the progress on the display of the unit. The TV screen may remain black until the update is complete and the power is turned on again.
 - "Completed!" is displayed when the update is complete.
4. Press ON/STANDBY on the main unit to turn the unit into standby mode.

The process is completed and your firmware is updated to the latest version.

 - Do not use RECEIVER on the remote controller.